

## Radon Inspection Report

### Test Location:

  
Wake Forest, NC 27587  
contact@inspectorjoenc.com

### Test For:

  
Wake Forest, NC 27587  
contact@inspectorjoenc.com

### Inspected By:

Jay Story  
2500 Regency Parkway  
Cary, NC 27518  
919-295-0064  
Lic/Cert. # 111034 RT (NRPP)

Bldg. Type: Residential Single Family    Type: Real Estate Transaction



## Test Result: Below EPA Recommended Action Level

Overall Average:

**2.0 pCi/l**

EPA Average:

**2.0 pCi/l**

### Test Device Details:

Serial Number: 300002157  
Model Number: 1030  
Last Calibration: 11/18/2023  
Next Calibration: 11/18/2024  
Cal-Factors: 2.53,2.57,2.58,2.54,2.50,2.49  
Motion Error: No

### Test Site Condition:

Condition: Clear and Dry  
Structure Type: Condo  
Year Built: 2023  
Sq Ft: 2228

### Test Summary:

CRM Location:	Start:	Stop:	Interval:	Duration:
Living Room	11/16/2024 03:33 AM	11/18/2024 03:33 AM	1 hr	48 hr

*First 4 hrs of data excluded	Min:	Max:	Average:	Measurement Units:
Radon Concentration:	1.1	2.9	2.0	pCi/l
Temperature	68.2	72.5	69.5	F
Humidity	46	49	48	%
Pressure	29.65	29.82	29.74	inHg


### Comments:

Please see EPA guidelines on the last page of this report.

Lic/Cert Signature

Inspection Report Date: 11/18/2024

## Radon Inspection Chart

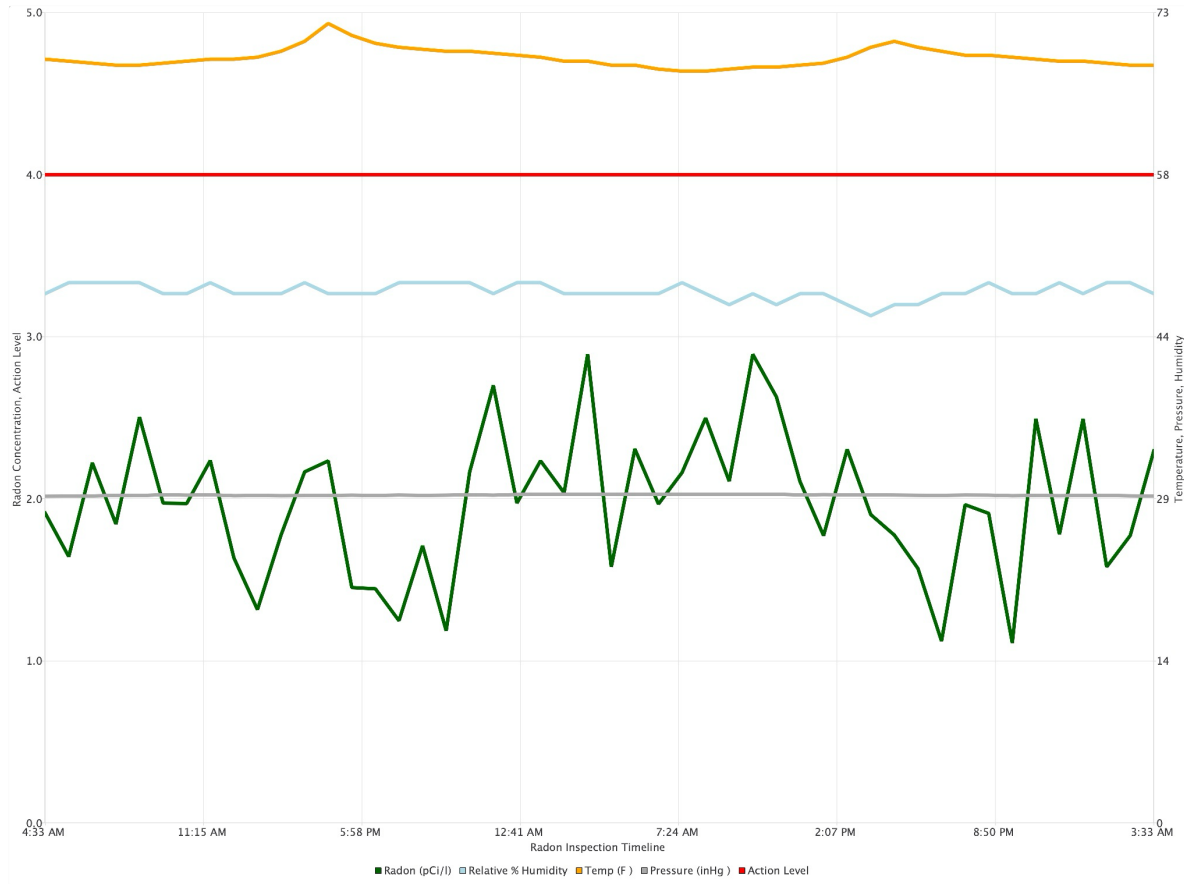

**Test Result: Below EPA Recommended Action Level**

**Test Location:** [REDACTED] Wake Forest, NC 27587

**Inspection Report Date:** 11/18/2024

## Test Checklist

- ☒ The location of the detector was selected so the detector was not to be disturbed during testing.
- ☒ The monitor was not placed in an area of high humidity such as: Kitchen, laundry room, cellar, spa room, garage, crawl space or sump area.
- ☒ The detector was not located near drafts caused by HVAC vents, windows and doors.
- ☒ The detector was not placed near areas of excessive heat, such as a fireplace or in direct sunlight.
- ☒ The detector was placed within the breathing zone of at least 20 inches to 6 feet above the floor and at least 1 foot below the ceiling if suspended.
- ☒ The detector was not placed within 1 foot of outside walls of the home or within 3 feet of any windows or doors to the exterior of the home.
- ☒ Ceiling fans, portable dehumidifiers, portable humidifiers, portable air filters, and all window air conditioners are not operated within 20 feet of the detector.

### Test Result: Below EPA Recommended Action Level

Test Location:  Wake Forest, NC 27587

Inspection Report Date: 11/18/2024

## Test Table

\* Data from first 4 hours excluded from EPA calculations

Date/Time	Radon(pCi/l)	Temp(F)	Pres(inHg)	Humidity(%)	Flags
11/16/24 04:33 AM	1.9	69.3	29.63	48	-
11/16/24 05:33 AM	1.6	69.1	29.64	49	-
11/16/24 06:33 AM	2.2	68.9	29.66	49	-
11/16/24 07:33 AM	1.8	68.7	29.71	49	-
11/16/24 08:33 AM	2.5	68.7	29.69	49	-
11/16/24 09:33 AM	2.0	68.9	29.77	48	-
11/16/24 10:33 AM	2.0	69.1	29.73	48	-
11/16/24 11:33 AM	2.2	69.3	29.76	49	-
11/16/24 12:33 PM	1.6	69.3	29.68	48	-
11/16/24 01:33 PM	1.3	69.4	29.70	48	-
11/16/24 02:33 PM	1.8	70.0	29.68	48	-
11/16/24 03:33 PM	2.2	70.9	29.69	49	-
11/16/24 04:33 PM	2.2	72.5	29.70	48	-
11/16/24 05:33 PM	1.5	71.4	29.73	48	-
11/16/24 06:33 PM	1.4	70.7	29.70	48	-
11/16/24 07:33 PM	1.2	70.3	29.74	49	-
11/16/24 08:33 PM	1.7	70.2	29.71	49	-
11/16/24 09:33 PM	1.2	70.0	29.73	49	-
11/16/24 10:33 PM	2.2	70.0	29.77	49	-
11/16/24 11:33 PM	2.7	69.8	29.73	48	-
11/17/24 12:33 AM	2.0	69.6	29.79	49	-
11/17/24 01:33 AM	2.2	69.4	29.80	49	-
11/17/24 02:33 AM	2.0	69.1	29.82	48	-
11/17/24 03:33 AM	2.9	69.1	29.80	48	-
11/17/24 04:33 AM	1.6	68.7	29.82	48	-
11/17/24 05:33 AM	2.3	68.7	29.81	48	-
11/17/24 06:33 AM	2.0	68.4	29.80	48	-
11/17/24 07:33 AM	2.2	68.2	29.80	49	-
11/17/24 08:33 AM	2.5	68.2	29.82	48	-
11/17/24 09:33 AM	2.1	68.4	29.81	47	-
11/17/24 10:33 AM	2.9	68.5	29.82	48	-
11/17/24 11:33 AM	2.6	68.5	29.82	47	-
11/17/24 12:33 PM	2.1	68.7	29.75	48	-
11/17/24 01:33 PM	1.8	68.9	29.78	48	-
11/17/24 02:33 PM	2.3	69.4	29.76	47	-
11/17/24 03:33 PM	1.9	70.3	29.75	46	-
11/17/24 04:33 PM	1.8	70.9	29.74	47	-
11/17/24 05:33 PM	1.6	70.3	29.72	47	-
11/17/24 06:33 PM	1.1	70.0	29.71	48	-
11/17/24 07:33 PM	2.0	69.6	29.74	48	-
11/17/24 08:33 PM	1.9	69.6	29.73	49	-
11/17/24 09:33 PM	1.1	69.4	29.68	48	-
11/17/24 10:33 PM	2.5	69.3	29.70	48	-
11/17/24 11:33 PM	1.8	69.1	29.68	49	-

### Test Result: Below EPA Recommended Action Level

Test Location: XXXXXXXXXX Wake Forest, NC 27587

Inspection Report Date: 11/18/2024

## Test Table

\* Data from first 4 hours excluded from EPA calculations

Date/Time	Radon(pCi/l)	Temp(F)	Pres(inHg)	Humidity(%)	Flags
11/18/24 12:33 AM	2.5	69.1	29.70	48	-
11/18/24 01:33 AM	1.6	68.9	29.71	49	-
11/18/24 02:33 AM	1.8	68.7	29.67	49	-
11/18/24 03:33 AM	2.3	68.7	29.65	48	-

**Test Result: Below EPA Recommended Action Level**

**Test Location:**  Wake Forest, NC 27587

**Inspection Report Date:** 11/18/2024

## Radon Test Information

### Radon Risk Information

Radon causes lung cancer by means of the decay of its daughter products after breathing in air contaminated with higher levels of Radon. The World Health Organization (WHO) estimates that 15% of lung cancers worldwide are caused by exposure to elevated indoor levels of Radon. Overall, radon is the second leading cause of lung cancer responsible for about 21,000 lung cancer deaths every year in the US alone. Radon gas is the number one cause of lung cancer among non-smokers. The U.S. Environmental Protection Agency (EPA), the U.S. Surgeon General, and the Center for Disease Control and Prevention (CDC) strongly recommend that ALL homebuyers have an indoor radon test performed prior to purchase or taking occupancy and recommend having the radon levels professionally mitigated if elevated radon concentrations are found.

### Understanding Radon Test Results

Recommended Action Levels vary by country and typically range from 3 pCi/l (100 Bq/m<sup>3</sup>) to 8 pCi/l (300 Bq/m<sup>3</sup>). Recommendations below are based on test results by a Continuous Radon Monitor (CRM) Test of at least 48h duration and are based on recommendations by the EPA.

Measured Average Radon Level:

- At or above 4.0 pCi/l (148 Bq/m<sup>3</sup>): Corrective measures to reduce exposure to radon gas is strongly recommended (ANSI MAH2014)
- Between 2-4 pCi/l (74-148 Bq/m<sup>3</sup>): Consider mitigation or periodic retest as indoor Radon levels vary by season and weather conditions
- Below 2 pCi/l (74 Bq/m<sup>3</sup>): Consider bi-annual retest or whenever significant changes to the home structure or mechanical systems occurred

### Test Result: Below EPA Recommended Action Level

Test Location:  Wake Forest, NC 27587

Inspection Report Date: 11/18/2024